Site HOTO Report — SYL_X0087

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 07-Nov-2026 02:48 BD time

100%	15/15	0	0	5
FORM COMPLETION	CHECKLIST OK	OPEN SNAGS	TOTAL SNAGS	PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0087	ZONE	Sylhet
HOTO DATE	2026-09-04	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech Ltd	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwer	TAKEOVER PERSON	Md. Ismail hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426758
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	No	SHARED OPERATOR NAME	N/A

GENERATOR INFORMATION

DG BRAND	Tempest	GENSET ASSET NO.	2001001IBAL
CAPACITY (KVA)	20	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	446.4
FUEL (NO WATER)	212 L	FUEL (TOTAL)	212 L
WATER AMOUNT	— L	FUEL AMOUNT (WORD)	Two Hundred Twelve Liters
DG SITE TYPE	Standard	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	PO33WLDB0008
BATTERY AH	100	ENGINE SERIAL	GV51790U884143B
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-08-23
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	0	FAULTY/DISCONNECTED TANKS	0

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	45
Frequency (Hz)	50.1	Phase	3 Phase
Output	400	Engine Brand	Perkings
Voltage L1-L2	400	Voltage L2-L3	400
Voltage L3-L1	399	Voltage L1-N	230
Voltage L2-N	229	Voltage L3-N	230
Current Line 1	15	Current Line 2	15
Current Line 3	15	N-G	2.7
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

SNAGS FOUND (0)

No snags logged for this visit.

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	—
SAFETY REMARKS	—
GENERAL REMARKS	PDF checklist notes: All checklist items marked OK, no NOK, no snags noted. DG last servicing date noted 23-8-26. A circled '15' appears at the top of the page (page/batch numbering, not form data).

SITE PHOTOS



Site / Nameplate



DG RH / Meter



Fuel Gauge

 Additional	 Additional

Md. Anwer
Handed Over By · Dhaly Infratech Ltd
01734713807

Date: _____

Md. Ismail hossain
Taken Over By · Alliance Computers Limited
01847426758

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (5)

Full-size reference photos for SYL_X0087, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)

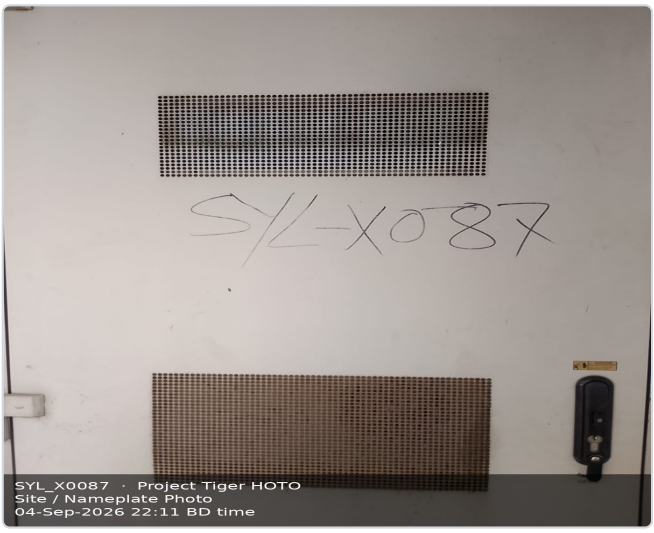


Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

ADDITIONAL PHOTOS (2)



Photo 4 — Additional Photos 1

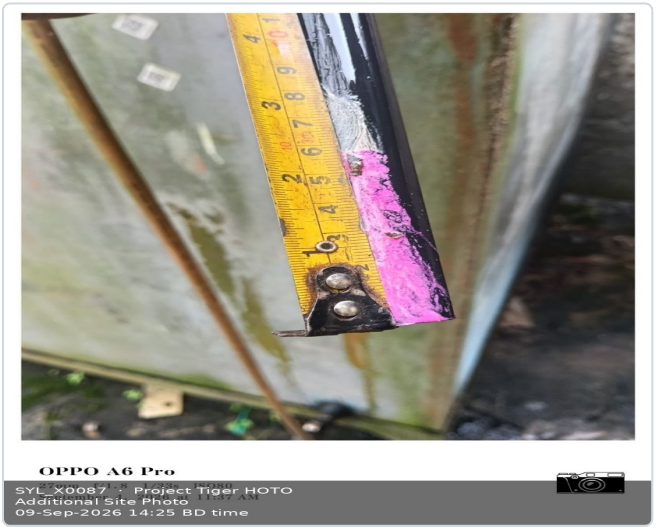


Photo 5 — Additional Photos 2