Site HOTO Report — SYL_G0422

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 08-Nov-2026 03:46 BD time

100%	15/15	1	1	4
FORM COMPLETION	CHECKLIST OK	OPEN SNAGS	TOTAL SNAGS	PHOTOS ATTACHED

SITE & HANDOVER DETAILS

SITE CODE	SYL_G0422	ZONE	Sylhet
HOTO DATE	2026-09-06	DISTRICT	Sunamganj
HANDOVER ORG	Dhaly Infratech	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Anwar Hossain	TAKEOVER PERSON	Ismail Hossain
HANDOVER PHONE	01734713807	TAKEOVER PHONE	01847426858
INSPECTED BY	Ismail Siraji	SECURITY GUARD	Yes
ACCESS KEY HANDED OVER	Yes	SITE TYPE	GFT
BTS TYPE	Outdoor		
SHARED WITH OPERATOR	Yes	SHARED OPERATOR NAME	Grameen Phone

GENERATOR INFORMATION

DG BRAND	FG Wilson	GENSET ASSET NO.	N/A
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	2000	PRESENT RH	142
FUEL (NO WATER)	277 L	FUEL (TOTAL)	369 L
WATER AMOUNT	90 L	FUEL AMOUNT (WORD)	Three Hundred Sixty Nine Liters
DG SITE TYPE	Remote	DG LOCKED AFTER FUELING	Yes
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033XHBK0641
BATTERY AH	100	ENGINE SERIAL	HP35203U935011S
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	—
KEY TYPE	Local Key	KEY STATUS — BTS	Local
KEY STATUS — DG ROOM	Local		
ACTIVE DG	1	CONNECTED FUEL TANKS	1

FAULTY/DISCONNECTED DG	—	FAULTY/DISCONNECTED TANKS	—

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	45
Frequency (Hz)	49.7	Phase	3 Phase
Output	400	Engine Brand	Perkings
Voltage L1-L2	401	Voltage L2-L3	401
Voltage L3-L1	400	Voltage L1-N	231
Voltage L2-N	231	Voltage L3-N	230
Current Line 1	15	Current Line 2	15
Current Line 3	15	N-G	2.4
Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation (VDTC/RVDTC/Rectifier) per BL Standard	OK	Fuel Preserved at Safe & Appropriate Location	OK
Exhaust Fan / Ventilation Sufficient When Running	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
DG Runs in Both Auto & Manual Mode	OK	GENSET ON Alarm Functioning Properly	OK
Lub Oil Status (Level & Colour)	OK	DG RH Meter Working Properly	OK
No Parts Missing (if missing, note in snags below)	OK		

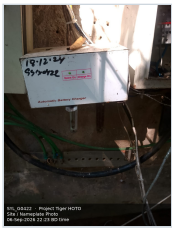
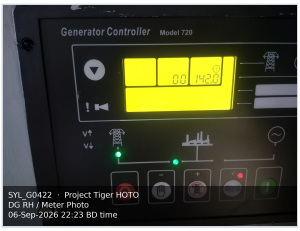
SNAGS FOUND (1)

SNAG #	SYSTEM	CATEGORY	COMPONENT	STATUS	OBSERVATIONS	ACTION	PHOTO
S-064	DG	DG - Other	No servicing date found.	Faulty	—	Open	

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	There is another dg canopy at this site.
SAFETY REMARKS	—
GENERAL REMARKS	PDF checklist notes: Site ID field shows crossed-out 'SYL_XG' corrected to 'SYL_G_422' (i.e. SYL_G0422). All checklist items marked OK, no NOK found. Note near meter reading area shows 'FG Wilson' and a crossed-out number '141.9' next to RH reading 192.0 - possibly an alternate/previous meter reading, ambiguous. Remarks noted '1 pcs only canopy'. ATS brand field left blank. Handing-over vendor participant's full name illegible (only 'Amz' and phone legible). No BL concern name/signature entered.

SITE PHOTOS

 Site / Nameplate	 DG RH / Meter	 Fuel Gauge

Md. Anwar Hossain
Handed Over By · Dhaly Infratech
01734713807

Date: _____

Ismail Hossain
Taken Over By · Alliance Computers Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____

APPENDIX — PHOTO EVIDENCE (4)

Full-size reference photos for SYL_G0422, grouped by type and numbered for cross-reference against the tables above.

REQUIRED SITE PHOTOS (3)



Photo 1 — Site / Nameplate



Photo 2 — DG RH / Meter



Photo 3 — Fuel Gauge

SNAG EVIDENCE PHOTOS (1)



Photo 4 — S-064 — No servicing date found.