

Site HOTO Report — SYL_X0073

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 31-Aug-2026 21:00 BD time

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0073	ZONE	Sylhet
HOTO DATE	2026-08-30	DISTRICT	Sylhet
HANDOVER ORG	Dhali	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md.Bulbul Ahomed	TAKEOVER PERSON	Md. Ismail hossain
HANDOVER PHONE	01406394565	TAKEOVER PHONE	01847426858
INSPECTED BY	ismail siraji	SECURITY GUARD	Yes

GENERATOR INFORMATION

DG BRAND	Fg wilson	GENSET ASSET NO.	000
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	70	PRESENT RH	42.2
FUEL (NO WATER)	14 L	FUEL (TOTAL)	14 L
WATER AMOUNT	00 L	FUEL AMOUNT (WORD)	Fourtin
DG PRESENT STATUS	NOK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko 100Ah	BATTERY SERIAL	P8199420039
BATTERY AH	100	ENGINE SERIAL	35212u9527765
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	—
KEY STATUS — BTS	Local	KEY STATUS — DG ROOM	Local
ACTIVE DG	1	CONNECTED FUEL TANKS	00
FAULTY/DISCONNECTED DG	00	FAULTY/DISCONNECTED TANKS	1

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	45
Frequency (Hz)	49.2	Phase	3 Phase
Output	Ac volteg	Voltage L1-L2	398
Voltage L2-L3	397	Voltage L3-L1	398
Voltage L1-N	229	Voltage L2-N	229
Voltage L3-N	228	Current Line 1	15
Current Line 2	15	Current Line 3	15
N-G	.345	Engine Brand	Parkings

Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation per BL Standard	OK	Fuel Preserved at Safe Location	NOK
Exhaust Fan / Ventilation Sufficient	OK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	NOK
Runs in Auto & Manual Mode	OK	GENSET ON Alarm Functioning	OK
Lub Oil Status	OK	RH Meter Working Properly	OK
No Parts Missing	OK		

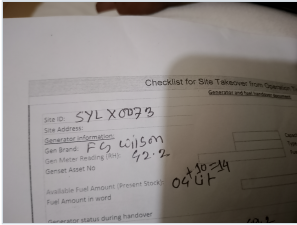
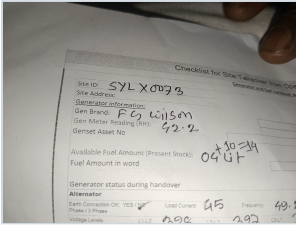
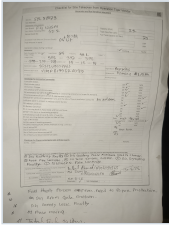
SNAGS FOUND (0)

No snags logged for this visit.

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1.DG Battery faulty 2.DG Battery cable aluminum need to change 3.Hose pipe leakage 4.Hi temperature sensor broken 5.DG Dynamo faulty 6.Silencer pipe leakage 7.DG Room gate Broken. 8.DG Canopy lock faulty 9.1 Phase missing 10.Fuel theft poren area need to poper protection.
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

 Site / Nameplate	 DG RH / Meter	 Fuel Gauge
---	---	---

Md.Bulbul Ahomed Handed Over By · Dhali 01406394565 Date: _____	Md. Ismail hossain Taken Over By · Alliance Computers Limited 01847426858 Date: _____	BL Concern · Name / Signature Date: _____
---	--	--