

Site HOTO Report — SYL_X0162

Project Tiger · Dhaly Infratech → Alliance Computers Limited · Generated 31-Aug-2026 21:00 BD time

SITE & HANDOVER DETAILS

SITE CODE	SYL_X0162	ZONE	Sylhet
HOTO DATE	2026-08-30	DISTRICT	Sylhet
HANDOVER ORG	Dhali	TAKEOVER ORG	Alliance Computers Limited
HANDOVER PERSON	Md. Bulbul Ahomed	TAKEOVER PERSON	Md. Ismail hossain
HANDOVER PHONE	01406394565	TAKEOVER PHONE	01847426858
INSPECTED BY	ismail siraji	SECURITY GUARD	Yes

GENERATOR INFORMATION

DG BRAND	Fg wilson	GENSET ASSET NO.	20060052IRA
CAPACITY (KVA)	22	TYPE	Can
FUEL TANK CAPACITY	1000	PRESENT RH	105.7
FUEL (NO WATER)	223 L	FUEL (TOTAL)	223 L
WATER AMOUNT	00 L	FUEL AMOUNT (WORD)	Two hundred twonti three
DG PRESENT STATUS	OK	GENSET ON ALARM	OK
BATTERY BRAND	Hamko	BATTERY SERIAL	P033wdcd0250
BATTERY AH	100	ENGINE SERIAL	Gv51792R
ATS BRAND	Local	ATS MODE	Auto
RH METER TYPE	Digital from controller	LAST SERVICE DATE	2026-08-22
KEY STATUS — BTS	Local	KEY STATUS — DG ROOM	Open space
ACTIVE DG	1	CONNECTED FUEL TANKS	1
FAULTY/DISCONNECTED DG	00	FAULTY/DISCONNECTED TANKS	00

CONNECTED GENERATOR CHECKLIST & READINGS

ITEM	VALUE	ITEM	VALUE
Earth Connection OK	Yes	Load Current (A)	40
Frequency (Hz)	58.8	Phase	3 Phase
Output	Ac voltage	Voltage L1-L2	412
Voltage L2-L3	411	Voltage L3-L1	412
Voltage L1-N	238	Voltage L2-N	237
Voltage L3-N	238	Current Line 1	16
Current Line 2	16	Current Line 3	8
N-G	0.365	Engine Brand	Perkins

Controller Status	OK	Black Smoke Status	OK
DG Battery Charger	OK	ATS Physical & Functional Status	OK
DG Automation per BL Standard	OK	Fuel Preserved at Safe Location	OK
Exhaust Fan / Ventilation Sufficient	NOK	Sufficient Water in Radiator & Battery	OK
DG Radiator Condition	OK	DG Battery Condition	OK
Runs in Auto & Manual Mode	OK	GENSET ON Alarm Functioning	OK
Lub Oil Status	OK	RH Meter Working Properly	OK
No Parts Missing	OK		

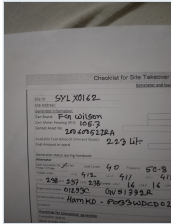
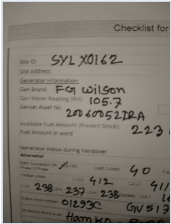
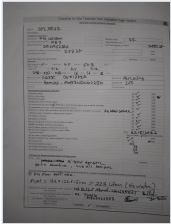
SNAGS FOUND (0)

No snags logged for this visit.

DEFICIENCIES & SAFETY REMARKS

DG MAJOR DEFICIENCIES	1) Dg fan belt not ok 2) lub oil sensor & hitem sensor disconnected
SAFETY REMARKS	—
GENERAL REMARKS	—

SITE PHOTOS

 Site / Nameplate	 DG RH / Meter	 Fuel Gauge
---	--	---

Md. Bulbul Ahomed

Handed Over By · Dhali
01406394565

Date: _____

Md. Ismail hossain

Taken Over By · Alliance Computers
Limited
01847426858

Date: _____

BL Concern · Name / Signature

Date: _____